


NOTES

FOR PRESTRESSED GIRDER REPAIR DETAILS, SEE "PRESTRESSED GIRDER REPAIR DETAILS AND SUMMARY" SHEET.

THE LOCATIONS AND DIMENSIONS OF THE AREAS FOR REPAIR ARE BASED ON THE BEST INFORMATION AVAILABLE. THE CONTRACTOR, IN CONJUNCTION WITH THE ENGINEER, SHALL VERIFY THE LOCATION AND EXTENT OF REPAIR AREAS PRIOR TO GIRDER REPAIR.

① GIRDER NUMBER

GIRDER REPAIR LOCATIONS			
GIRDER	LOCATION	REPAIR SIZE (L x W)	LABEL
2	BT. FL.	2'-2" x 6"	A
3	R.S. OF BT. FL.	6'-4" x 1'-1"	B
3	R.S. OF BT. FL.	1'-9" x 1'-1"	C
		1'-11" x 1'-1"	
3	BT. FL.	8" x 9"	D
3	WEB	1'-2" x 1'-3"	E
5	R.S. OF BT. FL.	2'-10" x 1'-0"	F
5	BT. FL.	2'-6" x 1'-0"	G

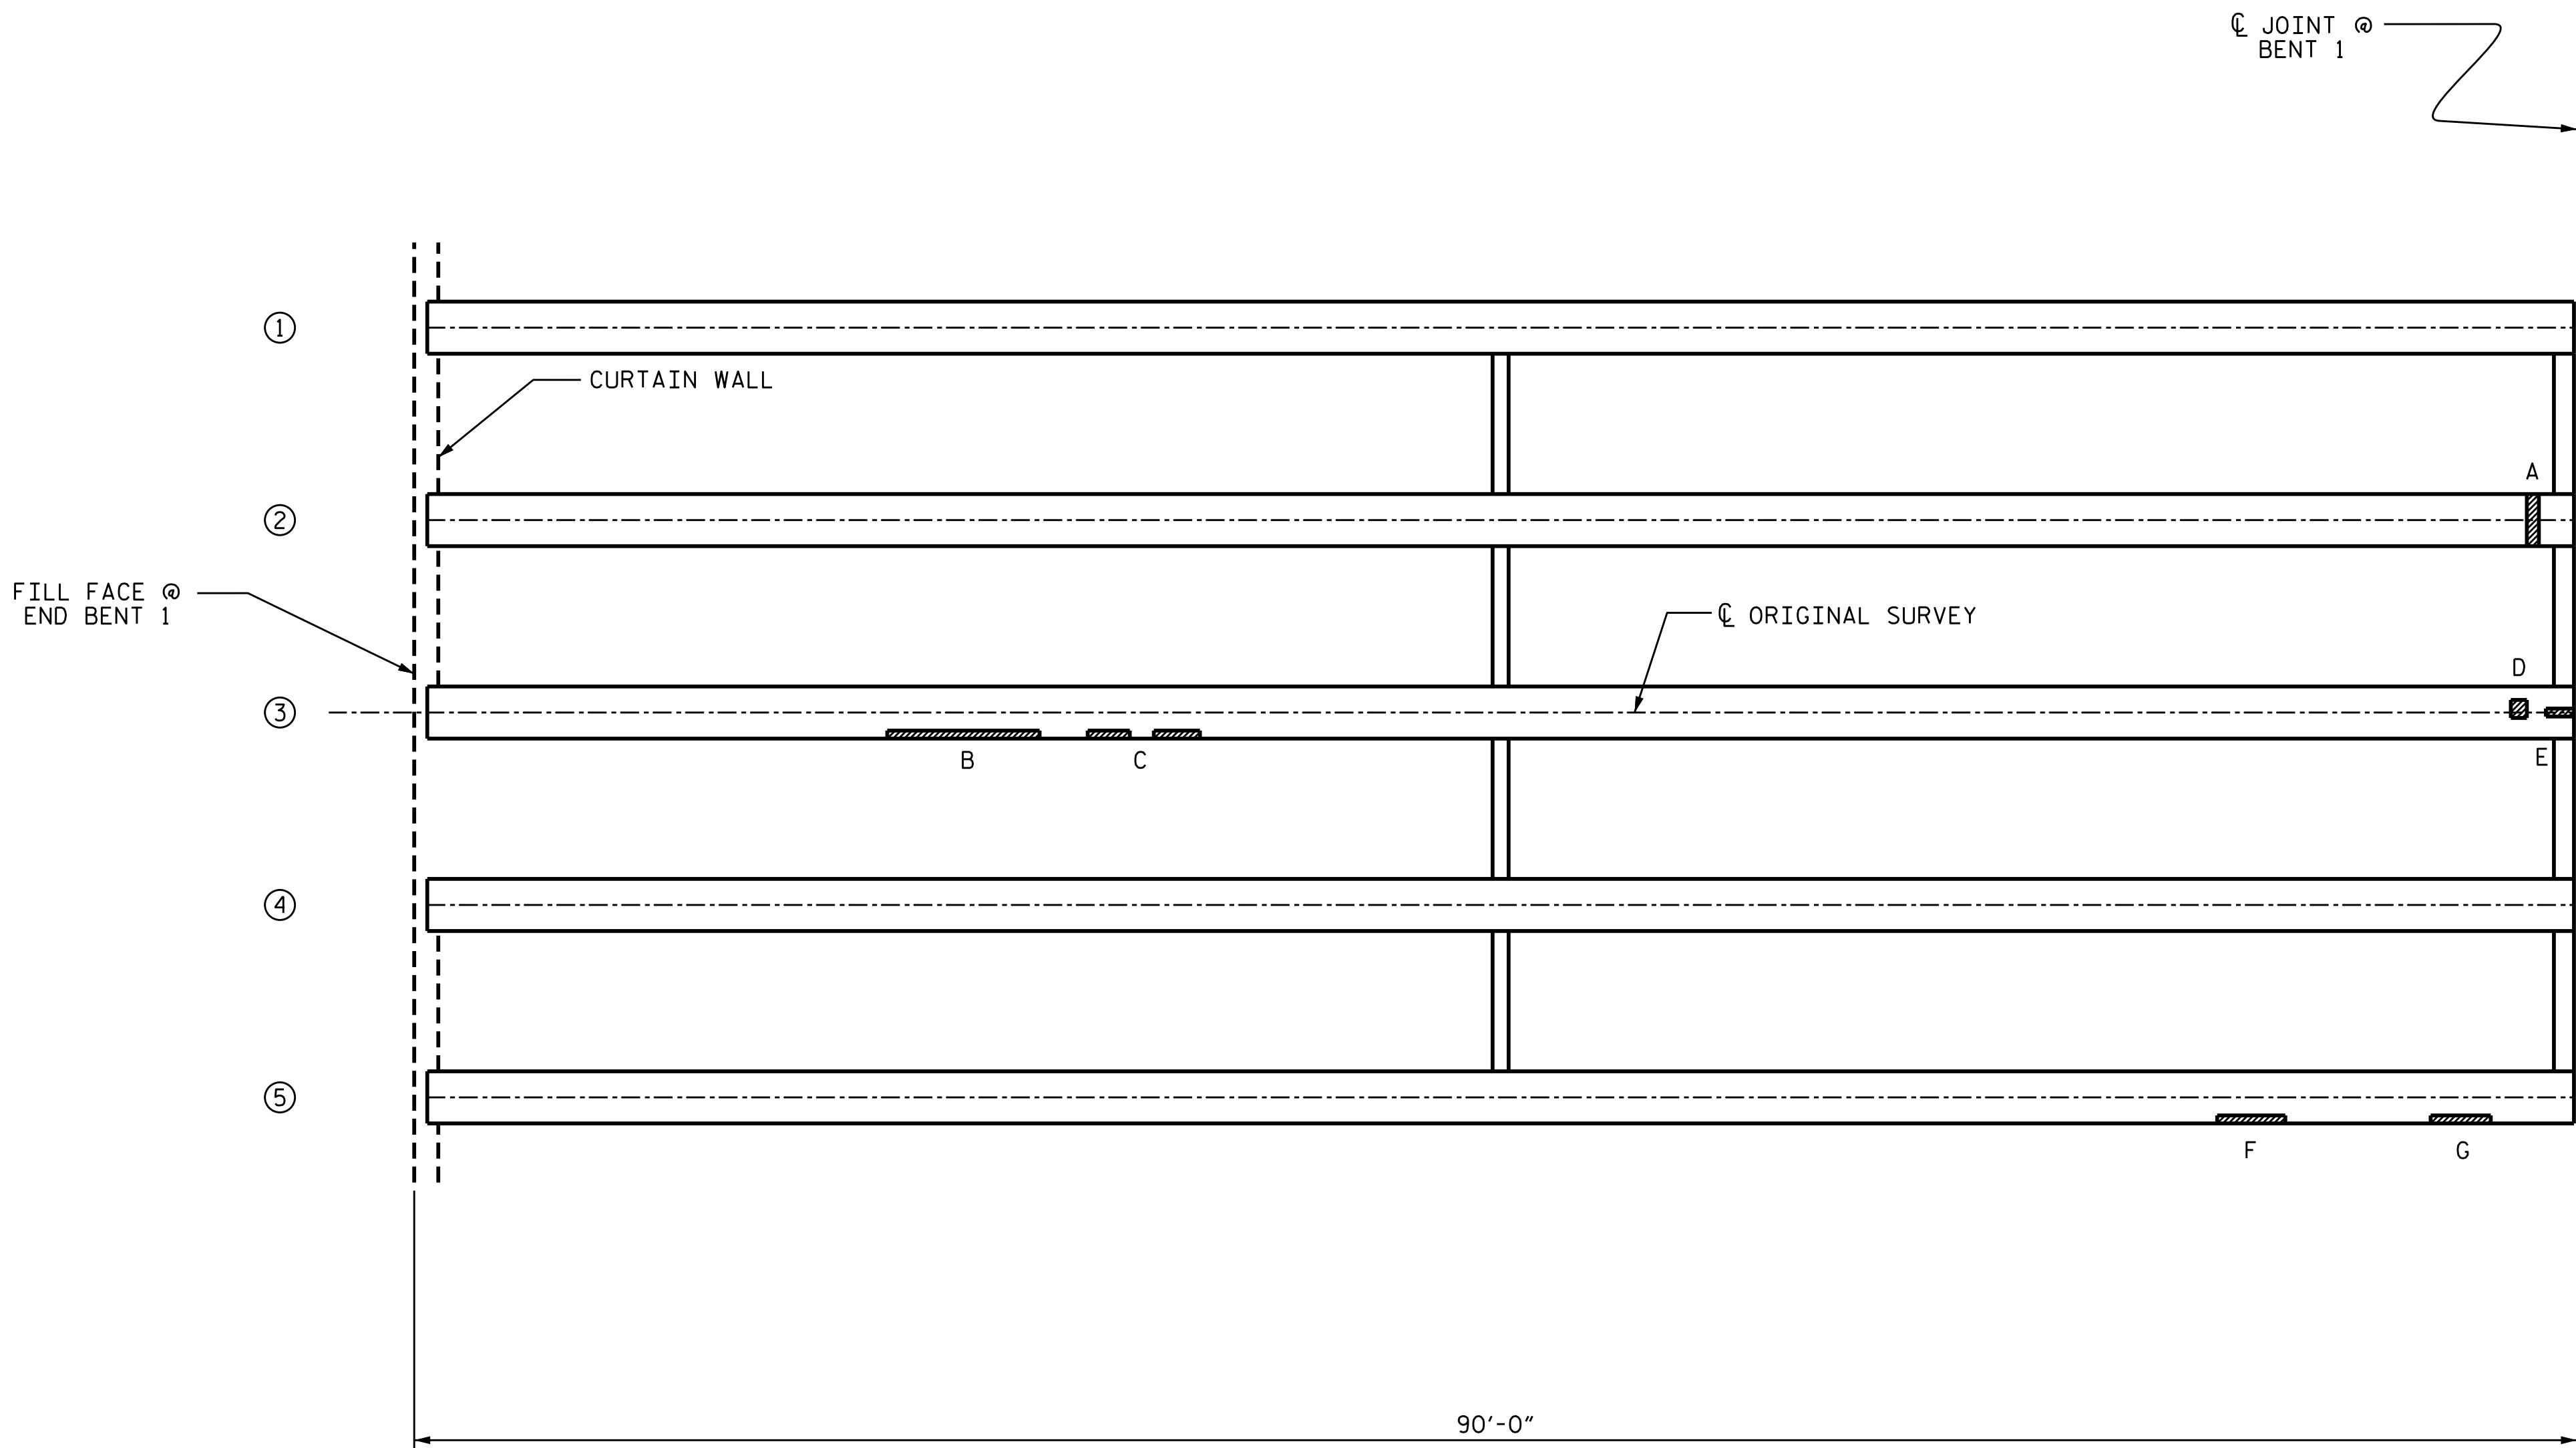

PRESTRESSED GIRDER REPAIR LOCATIONS


(OTHER LOCATIONS MAY EXIST, SEE NOTES)

PROJECT NO. 15BPR.18

DAVIE COUNTY

BRIDGE NO. 63

SHEET 1 OF 10

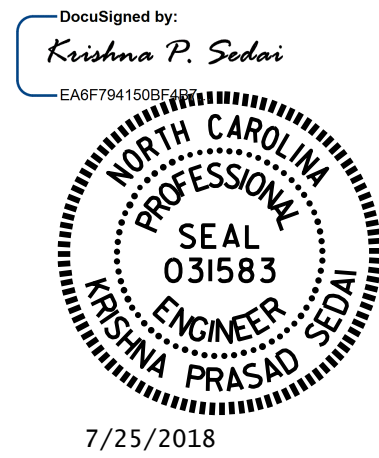

STATE OF NORTH CAROLINA					
DEPARTMENT OF TRANSPORTATION					
RALEIGH					
PRESTRESSED GIRDER REPAIR LOCATIONS					
SPAN A					
REVISIONS					SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:
1			3		
2			4		
DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED					TOTAL SHEETS 38

DRAWN BY : H.A. LOCKLEAR DATE : 6-18

CHECKED BY : M.G. SHAIKH DATE : 6-18